




EZ-195-QM-X
3190-6383




QMA Male (Plug) Straight Non- Solder
Pin No Braid Trim Connector for
LMR-195 Cable
YYWW

Made in China

Installation Instruction

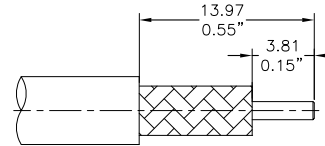

Recommended cable
stripping dim's

 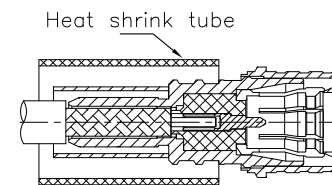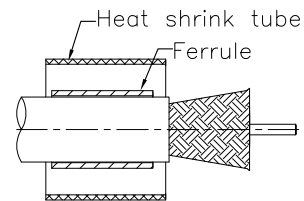

1. A. Trim cable to dimensions shown.
Be careful to avoid nicking the
inner and outer conductor.

2. A. Slide crimp ferrule and heat shrink
tube over the cable.
B. Flare the braid.

3. A. Insert cable into connector body until
dielectric is seated and center
conductor is inserted fully into
connector center pin.

4. A. Slide crimp ferrule over braid and
crimp as close to body as possible
using .213" HEX crimp tooling.
Pay attention to the crimp area, do
not crimp rear of crimp sleeve.

B. Heat shrink tube over rear of
connector body and down on to
cable jacket using hot air gun.

Times supply rubber boot 3109-445
(WSB-195/200) as an option to instead of
heat shrink tube.

Refer to www.timesmicrowave.com for install videos