



INSTALLATION INSTRUCTIONS EZ-1200-716MC-2 3190-2781


358 Hall Avenue/P.O. Box 5039 Wallingford, CT 06492-5039 Tel:203-949-8400 FAX:203-949-8423 1-800-TMS-COAX www.timesmicrowave.com

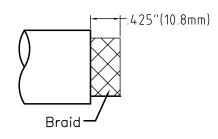

1. Cut the cable squarely and cleanly using the CCT-01 cutting tool. Use the ST-1200C-CH prep tool to remove the required length of jacket material

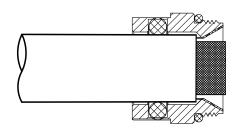

- 2. A. Wipe the O ring inside the back nut with the lubricant supplied with the connector
 - B. Place the connector squarely onto the cable and push while rotating the connector until the connector bottoms out on the jacket.
 - C. Run a finger around the outer edge of the dielectric to fan the braid wires away from the core

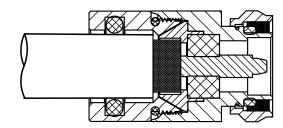

- 3. A. Snap the spring finger contact of the forward end of the connector into the center conductor of the cable
 - B. Using two 1 9/16" wrenches, hold the forward end firm while tightening the back nut to a value of 45N.m