


3 1 9 0 - 6 3 7 8

EZ-400-TM-PL-X
3190-6378

**TNC Male (Plug) Straight Non-Solder
Pin No Braid Trim Connector for
LMR-400-LLPL Cable
YYWW**


Made in China

Installation Instruction

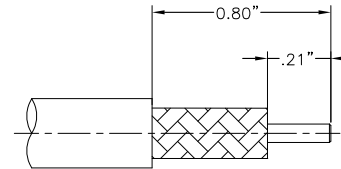


- 1.A. Cut the cable squarely while keeping it round using the CCT-01 cutting tool.
- B. Trim cable to the dimensions shown using the CST-400 prep tool.
- C. Remove any residual plastic from the center conductor.
- D. Debur center conductor using the CST-400 or a fine file.


Recommended cable stripping dim's

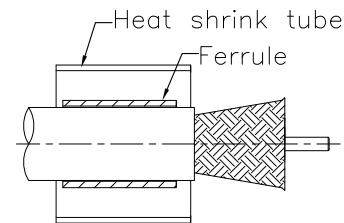


2. A. Slide crimp ferrule and heat shrink tube over the cable.
- B. Flare the braid.

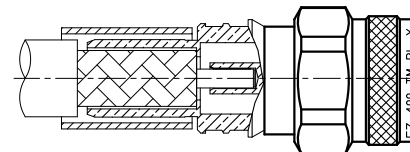

3. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector jack.

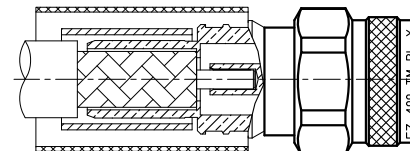

4. A. Slide crimp ferrule over braid and crimp as close to body as possible, using .429" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve.
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun.

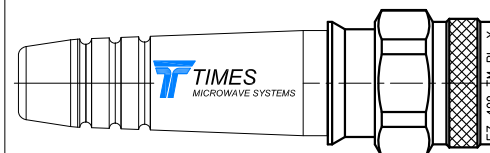

Times supply rubber boot 3109-394(WSB-400) as an option to instead of heat shrink tube.

Refer to www.timesmicrowave.com for install videos